

---

## Known fixes and bulletins

Bulletin

### Affected vehicles

- All models with console-mounted SRS control module.
- 106, 1997-12/98.
- 306, 01/96-12/98.
- 406, 1995-12/98.

### Problem

- SRS warning lamp illuminated.
- Pyrotechnic pretensioner faults stored.

### Cause

- Poor connection of pyrotechnic pretensioner multi-plugs under front seats.

### Remedy

Parts		
Description	Part number	Quantity
Cable tie - 106/306	698054	1
Cable tie - 406	698030	1

- Removal of pyrotechnic pretensioner multi-plugs under front seats.
- Disarm system.
- Replace pyrotechnic pretensioner multi-plugs with heat shrink connectors.

**NOTE: Follow manufacturer's guidelines when disarming and arming system.**