

## Known fixes and bulletins

Known fix

### Affected vehicles

- All models.

### Problem

- Erratic rear wiper operation.

### Cause

- Water ingress through rear wiper spindle into intermittent wiper relay.

### Remedy

- Check and clean intermittent wiper relay harness multi-plug contacts.
- Replace intermittent wiper relay if required.
- Place intermittent wiper relay inside a plastic bag. Secure plastic bag with cable tie.