Telephone: Fax:

# 3rd piston cut-off solenoid

Component disconnected

### Fig. 73559

Terminals	Condition	Typical value	Note
1 & 2		25-30 Ω	

## 3rd piston cut-off solenoid


Component disconnected

### Fig. 80919

Terminals	Condition	Typical value	Note
2 & earth	Ignition ON	11-14 V for 2 seconds then 0 V	2, 3

## Notes

- 2. Checking supply voltage.
- 3. Relay module must be fitted and working correctly in order to carry out supply voltage checks.

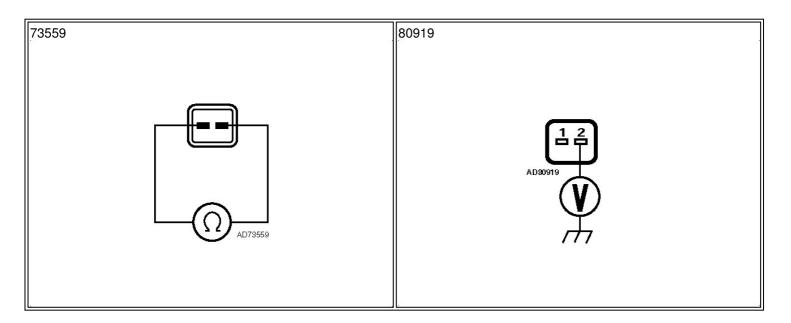

Manufacturer: Peugeot Model: 306 (97-03) 2,0D HDi Engine code: DW10TD (RHY) Output: 66 (90) 4000 Tuned for:

Vear: 1999-02